




PAUL N GARDNER COMPANY
9104 GUILFORD ROAD, SUITE H
COLUMBIA, MD 21046 USA

EMAIL: GARDCO@ALTANA.COM
PHONE: +1-954-946-9454

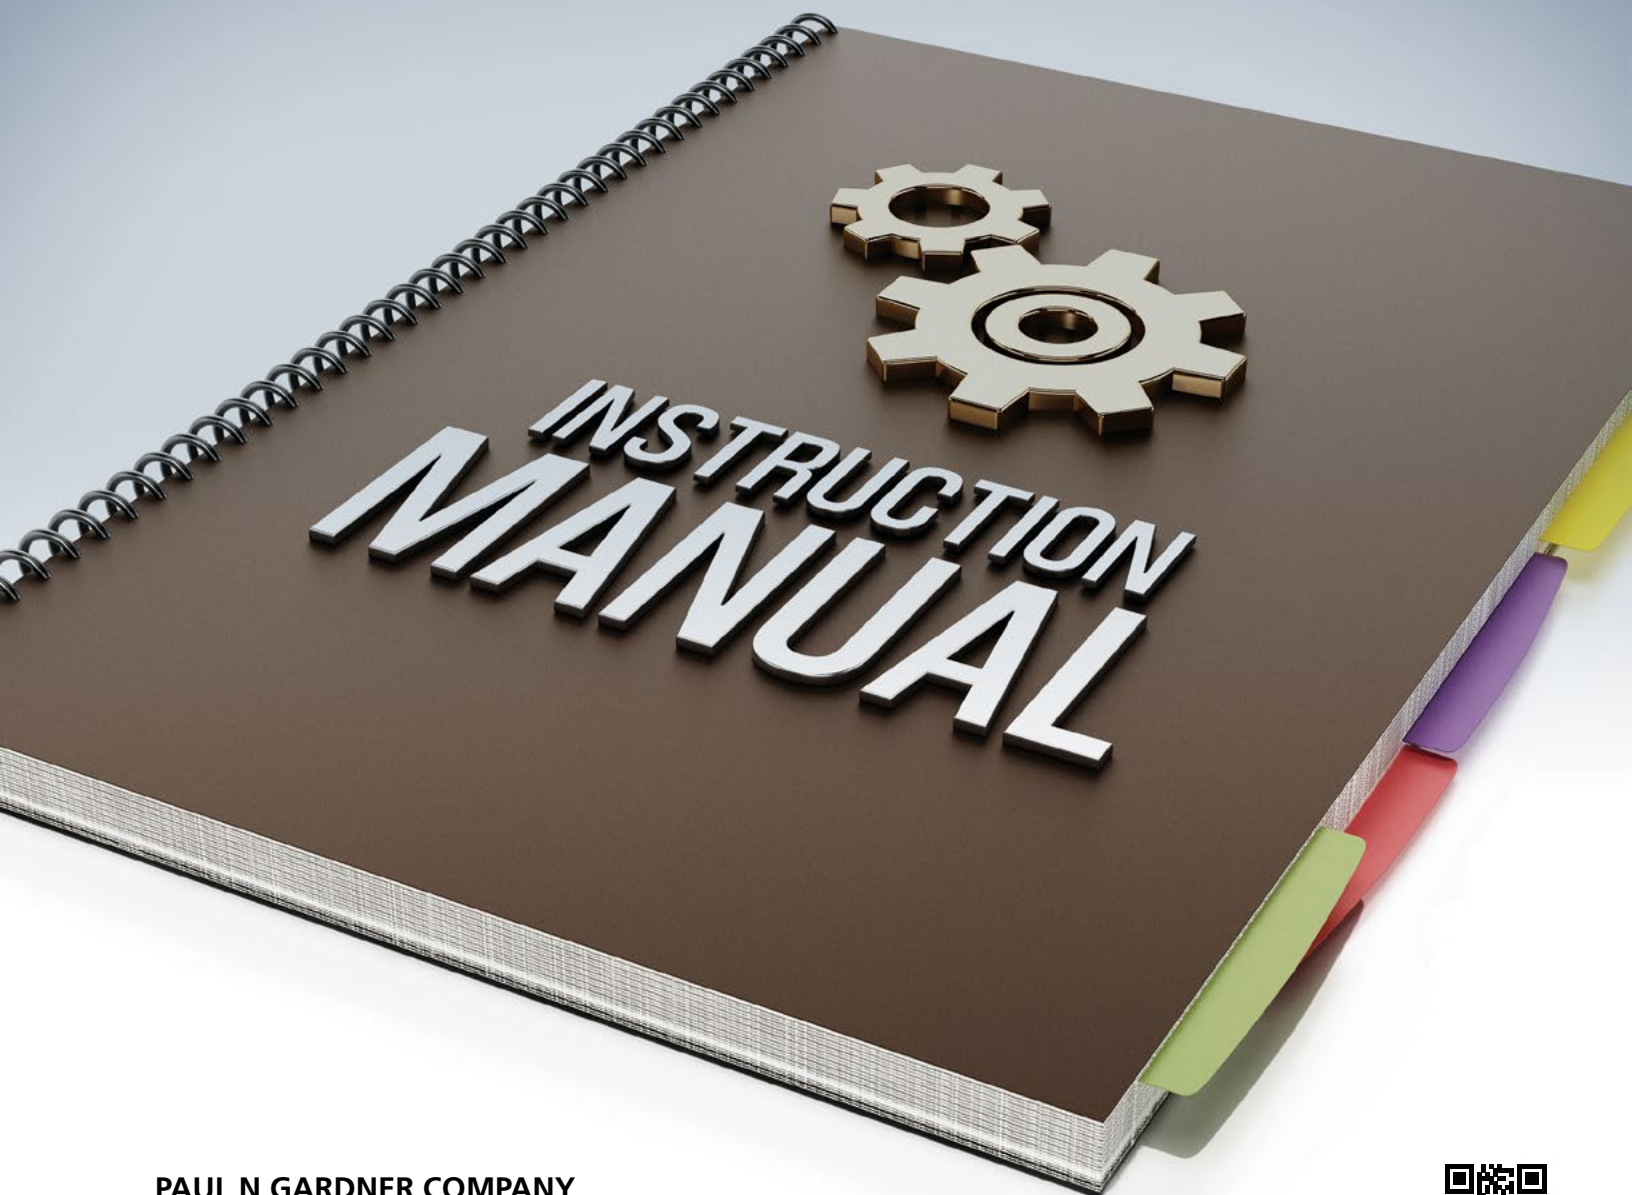

INSTRUCTIONS

GARDCO DISTRIBUTED PRODUCTS



Gardco IC Precision Wet Film Thickness Gauge Quick Start Manual

INSTRUCTIONS FOR USE

1. Clasp the gauge with the thumb and forefinger so that the gauge body is free to turn. Place the 0 - 1 mil range gauge on a freshly coated surface at the 1.0 mil (25 micron) graduation mark and roll the gauge one-half a revolution to the "0" mark. Lift the gauge and place on another part of the surface with the 1.0 mil mark in contact with the coating.
2. Then roll the gauge in the opposite direction to the "0" mark. Examination of the center disk will show thickness at which pickup of the wet coating thickness has taken place and the averaging of these values may be the true wet coating thickness.
3. IC Thickness Gauge is rolled over the film and the wet film thickness is read directly on either side of the gauge. Resolution of 0.05 mils (1.0 microns).

